

ATTENTION:

GENERAL MANAGER PARTS MANAGER
 CLAIMS PERSONNEL SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial



SERVICE BULLETIN

APPLICABILITY: 1999MY Legacy Vehicles

NUMBER: 11-60-00

SUBJECT: OBD II Code P0705

DATE: 04/12/00

Should you encounter a vehicle with a “Check Engine Light” indicator illuminated, and Code “P0705” stored in the Emission Control Unit (ECU), please perform the following procedure:

1. Confirm that all inhibitor switch circuit connections are **secure**.
2. Confirm that all inhibitor switch circuit connections are **clean and free of moisture**.
3. Insure that the inhibitor switch and shifter cable are **properly adjusted**.

If the above diagnostic procedures do not indicate any wiring or connection problems, the condition could be caused by an internal Transmission Control Unit (TCU) concern.

Should replacement be necessary, please use the chart below to order the correct control unit.

TCU PART NUMBER	MODEL
31711AE153	2.2L CAL SPEC
31711AE403	2.2L FED SPEC
31711AE163	2.2L POSTAL CAL SPEC
31711AE413	2.2L POSTAL FED SPEC
31711AE173	2.5L GT
31711AE183	2.5L OUTBACK

As always, you should have your parts department check for any supersessions prior to ordering and confirm the repair prior to returning the vehicle to the customer.

CAUTION

VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.