



SERVICE BULLETING

APPLICABILITY: 99MY & 2000MY Legacy, Forester, **NUMBER:** 16-65-99R

and Impreza Vehicles.

DATE: 04/03/00

SUBJECT: TCM Trouble Code 38 (Revised)

In the event you encounter a customer complaint of the A/T temperature light flashing and this code is found in the TCM, perform the following:

First, eliminate all wiring and connector concerns by performing the tests as outlined in the appropriate Service Manual for this code. Repair as necessary.

After you have checked and confirmed these items, and you still did not find any problems, we recommend you replace the following part(s).

Use the chart below to locate and order the correct part number(s) for your application.

VEHICLE MODEL	VEHICLE Emission Specifications	PART NUMBER(S)
99 Legacy 2.2	FED	31711AE403
99 Legacy 2.2 Postal	FED	31711AE413
99 Legacy GT 2.5	FED/CAL	31711AE173
99 Outback 2.5	FED/CAL	31711AE183
99 Legacy 2.2	CAL	31711AE153 &
		22611AD63B
99 Legacy 2.2 Postal	CAL	31711AE163 &
		22611AD64B
99 Impreza 2.2	FED	31711AE423
99 Impreza 2.2	CAL	31711AE313 &
		22611AE531
99 Impreza 2.5	FED/CAL	31711AE323
99 Forester 2.5	FED/CAL	31711AE233
00 Legacy 2.5 "L"	50 State Vehicle	31711AE10B
00 Legacy GT 2.5	50 State Vehicle	31711AE11B
00 Outback 2.5	50 State Vehicle	31711AE12B
00 Impreza 2.2	50 State Vehicle	31711AE531 &
		22611AE532
00 Impreza 2.5	50 State Vehicle	31711AE551
00 Forester 2.5	50 State Vehicle	31711AE671

Note: Refer to the Warranty Labor Time Guide for claim information.

CAUTION